

Release Notes for Ignite v10.4.2

Bug Fixes

[IGN-7580] Timeline containing switcher items may experience delays (1-2 seconds) during playout

- On some systems, Ignite may experience delays during the playout of a timeline containing switcher items. If these delays occur, they can be corrected by adding the following registry setting:

Key	HKEY_LOCAL_MACHINE\SOFTWARE\Wow6432Node\TBMS\IPS\Switcher
Value Name	DisableHWAcceleration
Value Type	DWORD
Value Data	1

[IGN-7731] Lawo mixer control may be lost when orphan master faders are present

- Ignite is now able to maintain control of the Lawo Mixer when orphan master faders are present

[IGN-7819] GPI-1501 card's GPOs may not get triggered with simultaneous GPO requests

- The communication between Ignite and GPI-1501 cards has been made compliant with the GPI-1501 card's protocol and is able to handle simultaneous GPO requests.
- It is required that the Densité controller card's firmware version is v2.3.1 or higher. Please contact the Grass Valley support team if this firmware update is required.

New Features

None.