

UDC-3901 – Upgrade Package 3.4.2

Upgrade Package Release History

| Release Version | Comprising: | | Release Date | Version Details | User Manual for this release (Miranda document #) |
|-----------------|------------------|------------------|--------------|----------------------|---|
| | Firmware Version | Software Version | | | |
| 3.4.2 | 3.4.2 | 3.4.2 | 2016.05.31 | (go) | M3062-9900-342 |

NOTES: The iControl compatibilities shown below are officially supported by Miranda. Earlier versions may also work, with bugs or limited features.
The Reference number (Ref#) given for each feature or bug in these Release Notes refers to internal Miranda documentation.

UPGRADE PACKAGE: **3.4.2** (INOUT:2369, VPROC:1191, MICRO:13)

Release date: 2016-05-31

iControl compatibility: 5.0 (build 17) and up

iControl Solo compatibility: 6.0 (build 89) and up

RCP-200 compatibility: NA

Custom software compatibility: NA

Hardware compatibility: This upgrade package applies to all existing hardware assemblies.

KNOWN BUGS & LIMITATIONS

| Ref # | Description |
|------------------------------|---|
| XVP3901-1763 | <p>Link a/b inversion when locked on 1080p59 Level B DL or 1080p50 Level B DL</p> <p>When locked on SDI input on 1080p59/50 Level B Dual Link we may have have a link a/b inversion on 1080p59/50 Level B Dual Link</p> |
| XVP3901-1717 | <p>1080p59/50 Level B DL SDI output offset</p> <p>SDI output has an OFFSET of 1 line when locked on 1080p59 Level B DL or 1080p50 Level B DL</p> |
| XVP3901-1673 | <p>Profile copy of USER PRESETs does not work.</p> <p>Using the profile function to copy a user preset from one card to another does not work: the destination card user preset will be corrupted when recalled (the same is true for all users 1 to 5). The problem does not occur if we use the "All" profile.</p> <p>WORKAROUND: Use the "Copy All" function.</p> |